

Erson Cams

7301 Global Dr
Louisville, KY 40258
PH: 800.641.7920



Part No.: **E112008**
Grind: **LSRH290-3A**
114 Lobe Separation Angle

Overlap: **64.00**

Intake Opens: **31.00** Exhaust Closes: **33.00**

Intake Closes: **79.00** Exhaust Opens: **81.00**

Running Clearance: _____ [Hot]

Valve Lift (Int / Exh): **0.578** **0.578**

Duration (Int / Exh): **290** **294**

Checking Figures @ .050" Tappet Rise

Overlap: **-0.50**

Intake Opens: **-1.50** Exhaust Closes: **1.00**


Intake Closes: **46.50** Exhaust Opens: **49.00**

Duration Intake: **225.0** Duration Exhaust: **230.0**

Lobe Lift Intake: **0.340** Lobe Lift Exhaust: **0.340**

Intake Center Line: **114**

Rocker Arm Ratio: **1.70**

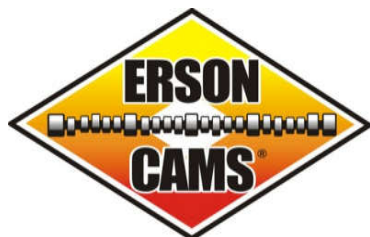

CAM NO. SPECIAL NOTES

| | |
|-------|--|
| 72338 | |
| | |
| | |